

**Technical Bulletin No:** XT501-09  
**Issue Date:** June 03  
**Vehicle:** X-Type 2002-03-MY-ON  
**VIN:** C00001-D29054

### **Loss Of Headlamp Washer Jet Cover - Poor Retention - Install Pre-painted Covers/Revised Link**

#### **Problem**

Some 2002-03 MY X-TYPE vehicles within the above VIN range may experience the loss of one or both covers from the headlamp power wash jets. Two new modified headlamp power-wash jet links and painted covers are to be installed, when one or both covers are missing.

#### **Action**

On a customer complaint basis only, install all the components from the repair kit when one or both covers are missing.

**Note:** Each kit includes two painted and modified covers and two modified links.

#### **WORKSHOP PROCEDURE**

1. Working on first headlamp power-wash jet, grip headlamp power-wash jet cover with fingers and slowly pull headlamp power-wash jet out to its operating position.  
**Note:** If headlamp power-wash jet cover is missing/lost, pull headlamp power-wash jet slowly out to operating position using pliers or hook.
2. Displace and remove headlamp power-wash jet cover from link if installed.
3. Displace and remove headlamp power-wash jet cover link from headlamp power-wash jet (Illustration 1).
4. Install and seat new link to headlamp powerwash jet (Illustration 2).  
**Note:** New link pegs are offset lowermost when installed for correct seating of cover to bumper.
5. Install new cover assembly to new link (Illustration 3).  
**Note:** Power-wash jet covers are marked on the rear face left hand or right hand.
6. Slowly release headlamp power-wash jet to its retracted position.
7. Repeat steps 1 to 6 to install remaining headlamp power-wash jet link and cover.