

Exterior Door Handle –
Noisy When Released –
Install New Rubber Buffers

MODEL 2002 MY-ON
X-TYPE

VIN C00001-ON

Issue:

On some X-TYPE vehicles, customers may have a concern of noise from the exterior door handle when released. This can be caused by missing or displaced exterior door handle rubber buffers.

Action:

In case of a verified customer complaint of the above condition, install new exterior door handle rubber buffers as outlined below.

1. Lift the exterior door handle 'up' and hold in the highest position.
2. Apply a suitable grease to the new rubber buffers (to aid installation).
3. Install the new rubber buffers to the exterior door handle.

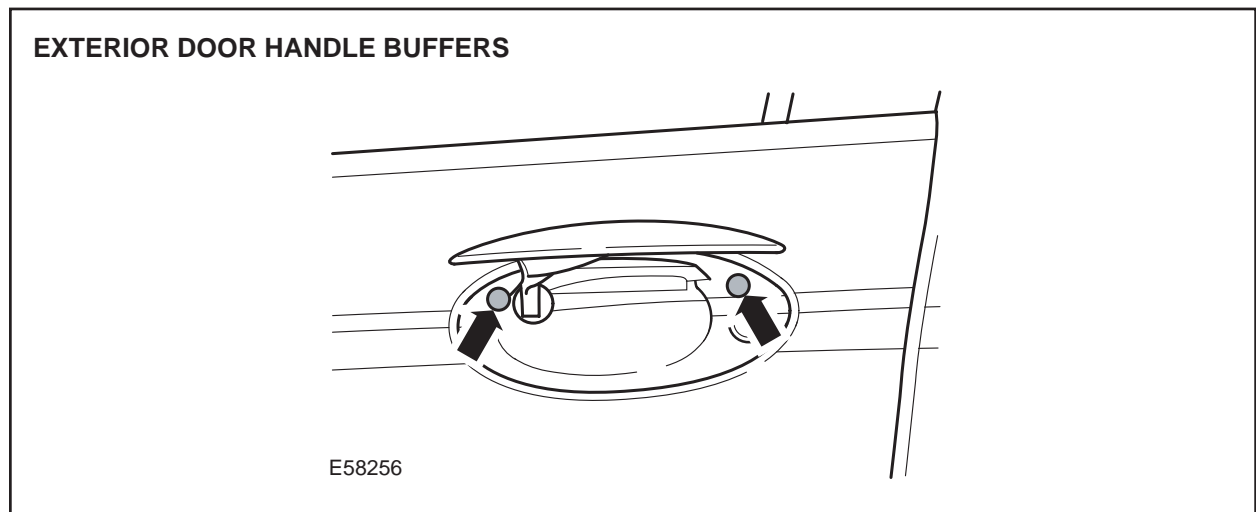


ILLUSTRATION 1

4. Release the exterior door handle.
5. If required, carry out steps 1 to 4 for the remaining exterior door handles.

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Exterior door handle rubber buffers	C2S 40545	2

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install exterior door handle rubber buffers	76.94.75	0.2 hrs.	C2S 40545