

Technical Bulletin No: XT303-181
Issue Date: Dec 04
Vehicle: X-Type 2002 MY-ON
VIN: C00001-ON

Engine Oil Leak Misdiagnosis - Vehicles With Automatic Transmission

Problem

On some 2002 MY-ON X-TYPE vehicles, the torque converter protection wax can soften and run on to the torque converter housing giving the appearance of an engine oil leak.

Action

Using a suitable cleaner, clean the wax/oil from the torque converter housing/sump area, then road test the vehicle, and recheck for the oil leak.

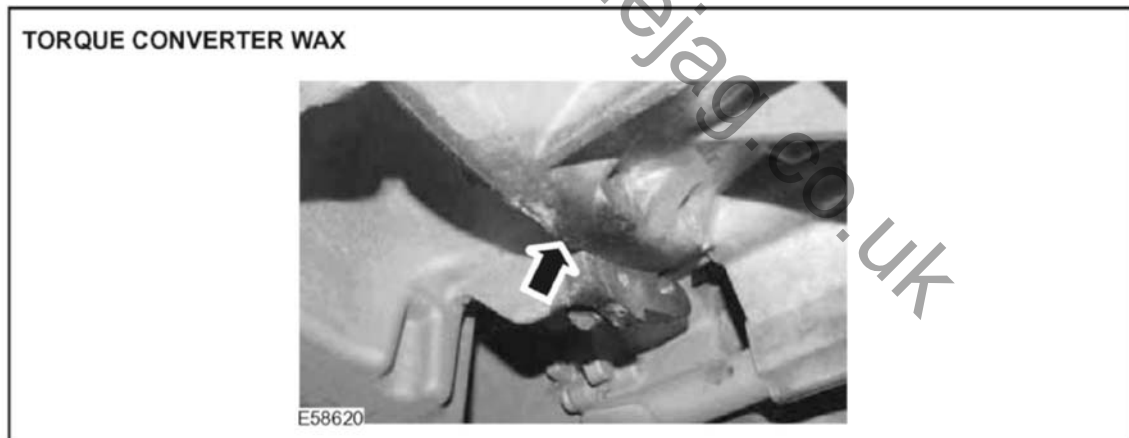


ILLUSTRATION 1

Refer to Illustration 2 for the difference in appearance between a torque converter wax (1) and a sump seal leak (2) collecting in the same location.

TORQUE CONVERTER WAX AND OIL SUMP SEAL LEAK

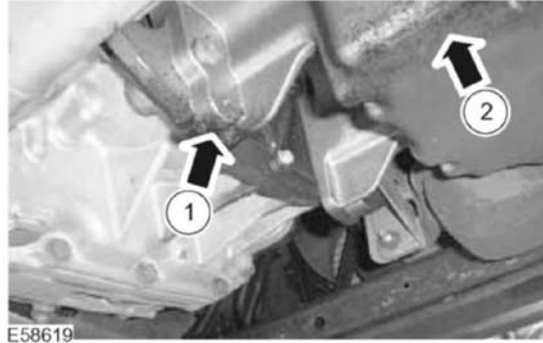


ILLUSTRATION 2

<http://www.bluejag.co.uk>